



TURNING SPACE AT BACK OF CURB

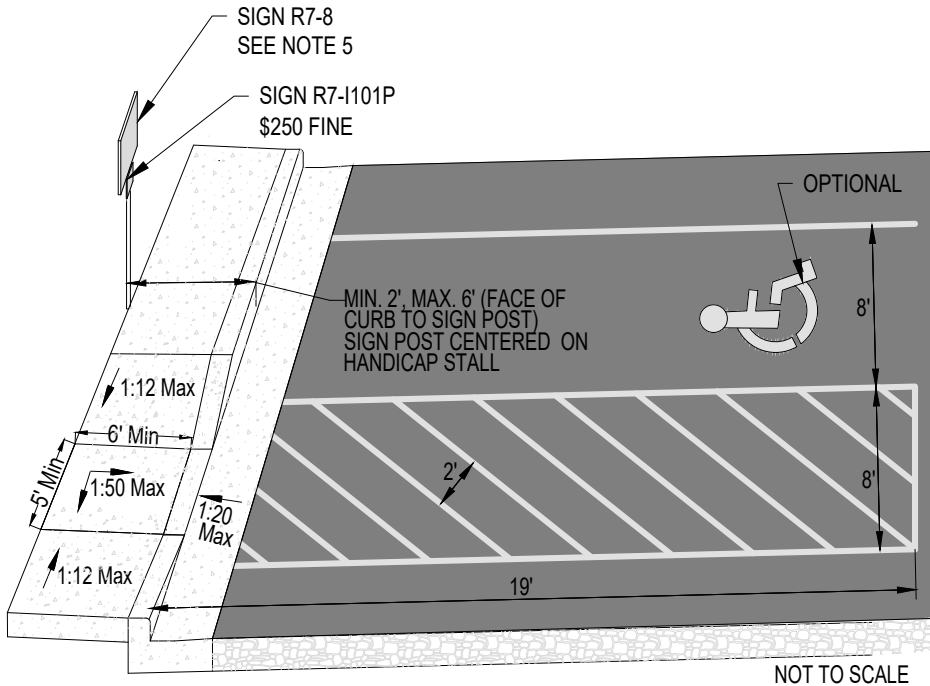

TURNING SPACE WITH CURB RAMP

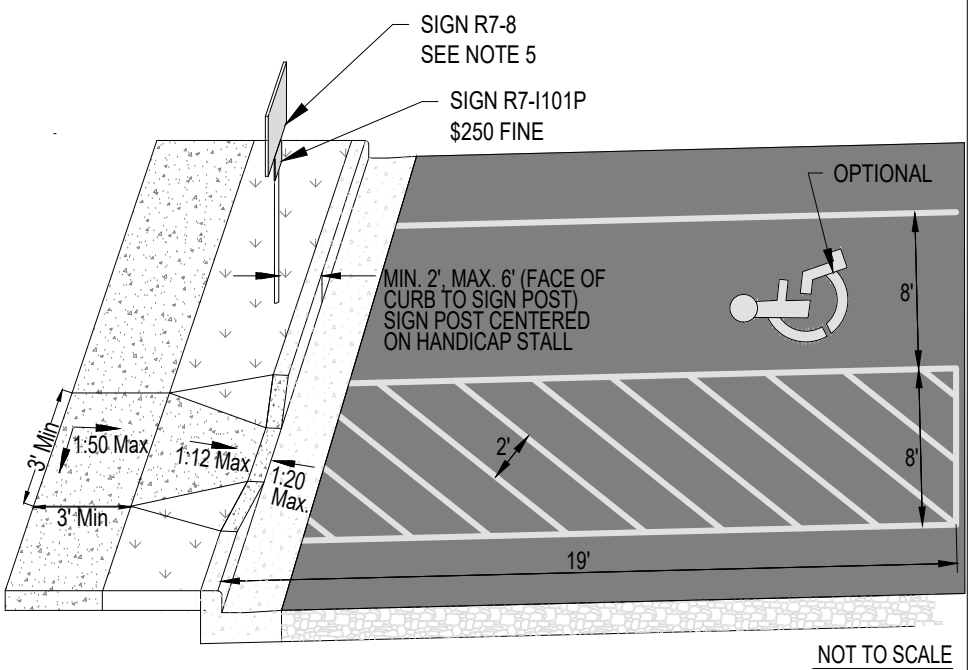

NOTES:

1. CONCRETE PARKING BUMPERS REQUIRED IF BARRIER CURB NOT PRESENT
2. REFER TO CURRENT EDITION OF THE ILLINOIS ACCESSIBILITY CODE, SECTION 502 PARKING SPACES
3. IF DEPRESSED CURB OPENING IS GREATER THAN 3.0 FEET, THE LANDING SHALL BE AS WIDE THE DEPRESSED OPENING.
4. MOUNT SIGNS SO BOTTOM OF R7-8 SIGN IS BETWEEN 5 FEET - 9 FEET ABOVE FINISH GRADE. MOUNT R7-I101P DIRECTLY BELOW.
5. TWO PARKING SPACES ARE PERMITTED TO SHARE A COMMON ACCESS AISLE IN PERPENDICULAR PARKING ONLY
6. PAVEMENT MARKINGS SHALL BE HIGH QUALITY YELLOW PAINT OR THERMOPLASTIC PER ILLINOIS ACCESSIBILITY CODE AND MUTCD.

Revised:
1. 06/12/2015
2. 3/22/2022 KL - Center sign, height, landing options specified.
3.
4.

Drawing Name

TYPICAL HANDICAP ACCESSIBLE PARKING STALL

Drawing Number	TR-06
Date:	06/01/2007
Drawn	Checked
EM	AW



City of
Crystal Lake
Illinois